



## SERVICE BULLETIN

|              |          |               |   |
|--------------|----------|---------------|---|
| <b>No:</b>   | SB169-17 |               |   |
| <b>Date:</b> | 16/06/17 | <b>Issue:</b> | 1 |

|                 |  |
|-----------------|--|
| <b>Subject:</b> | OLTP Elite 6 'RCV Not Ready' Displayed on Terberg Lift |
|-----------------|--|

It is possible to get the message '*RCV Not Ready*' displayed on the bin lift of an OLTP body when mounted to an Elite chassis.

This will result on both the body and the bin lift not working and can also lead to the truck being restricted to 30 KPH, to clear this fault you need to shut down the vehicle altogether and re-start the engine etc.

The reason behind this fault is a clash in message 122 from PLC 4 on the body to the cab PLC.

This fault can occur if the software in PLC 4 is version 4340002\_015 or higher, to rectify the fault the cab software needs updating to version 4000976\_011.

If you come across this fault please report it to your local DE Depot and they will update your cab PLC at the next convenient time for your operation.