

**No:**

SB174-17

**Date:**

08/08/17

**Issue:**


No. 1

**Subject:**

Elite 6 6x4 Rubber Suspension Settling In Phase Reference Re-Calibration

Within the first few weeks of service the Hendrickson Rubber Suspension will go through a settling in phase. This can be seen by a gap in the balance bar tie rod and rubber mount forming "X" see fig 1. The gap should be between 0-0.25mm

Fig 1

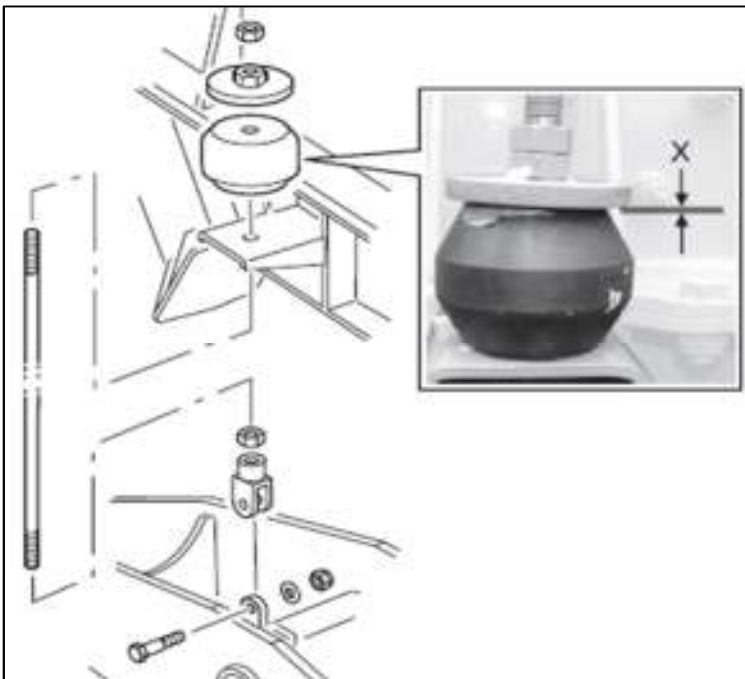

The instrument cluster may show you an air bag warning light with a fault code of SPN 521121 FMI 15 when the vehicle is loaded. This fault code indicates excessive load on axle 2 equating to the rear bogie.

If you have an Elite 6 with Hendrickson Rubber Suspension, it is recommended that you contact your local service centre after 3 weeks to have this recalibrated.