DENNIS EAGLE
RosRoca

SERVICE BULLETIN

No:	SB139-13	Issue:	2
Date:	27/08/13	Sheet:	Page 1 of 2

SUBJECT:	Volvo Engine Nox Sensor Failure

As from 1st January 2013, on vehicles that have been registered for more than 3 years from Date In to Service, Volvo will no longer accept Warranty claims for failed Nox Sensors.

One of the main reasons for Nox Sensor failure is water ingress and contamination, through jet washing, via the vertical exhaust pipe. Detergents used for washing vehicles and components may contain aggressive chemicals that could cause corrosion and damage to the Nox Sensor leading to failure and possible engine de-rate problems.

To attempt to alleviate Nox Sensor failure, Dennis Eagle have made available a 90º swept bend vertical exhaust outlet pipe which should help to prevent water ingress into the vehicle exhaust system and contamination of the Nox Sensor.

The new exhaust pipe is available to purchase through the Dennis Eagle Parts Department. Tel: No 01926 458555. See below for part number details.

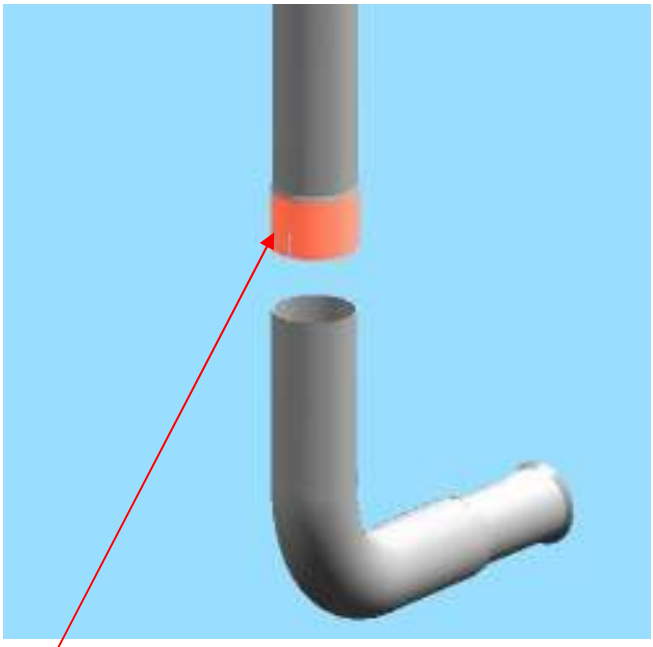

If the exhaust tailpipe has a swage, order part number 824028.

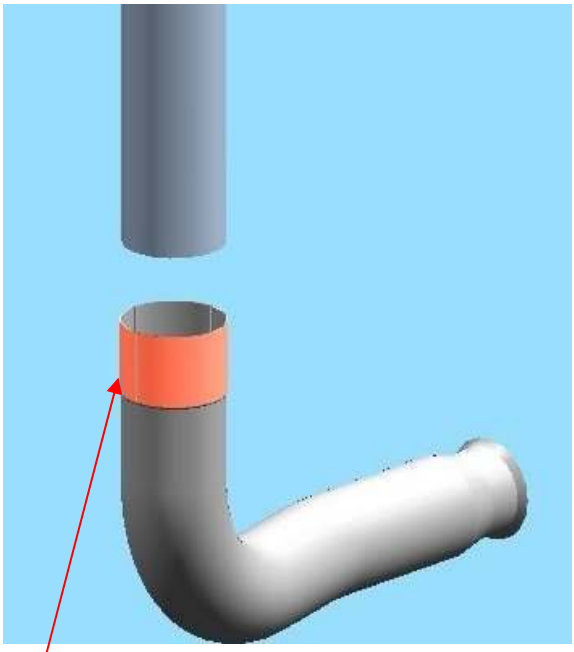

If the silencer outlet pipe has a swage, order part number 1025994.

Please note: Any vehicles fitted with either a Terberg Kerbsider Body/Pod will be supplied with a straight exhaust pipe (Part number 824147) and rain flap (Part number 619154). This is necessary to allow the Body/Pod to tip. If the rain flap is damaged or missing, this must be replaced to maintain warranty.